

Maritec Tanker Management Incident Reports Details

Ship File No : N/A Office File No : N/A Form No : N/A Issue : N/A Revision : N/A

: N/A

Rev Date

Vessel: Saint James LG Defect ID: 312 NCR #: 5/2023 Is NCR ?: Yes

Defect Details

During the arrival maneuvering in Panamaribo, I noticed in the ECR switchboard panel of the N.2 SW pump as the amperage has fluctuations between 50 and 70 A. Outside the ECR, could see the sparks and imediately began to visible fire on the pump. We stopped the pump imediately, switch off the power, isolated the valves and checked visual area. Bridge was informed in the same time.

The pump support has cracked.

The pump shaft under operation moves downside and starts to grinding to pump's support. Polishing the pump support appear the sparks which are visibly growing. The upper part of the mechanical seal begins to be affected and take fire.

Requisition Code:

Categories					
Primary :	Incident	Inspector - Internal:		Vessel Dept:	Engine
Secondary :	Other	Inspector External :		Office Dept:	Technical
		Inspection Date :			

Applicable Dates

Date Raised: 26-Apr-2023 ETC: 20-May-2023 Date Completed: 10-May-2023

Other Details

Priority: Normal Assigned By: Vessel Verified By: Nawin Khaware

Display in Daily Meeting?: No SFI: Verified On: 18/May/2023

Causes

Job Factors

Corrective Action

Support pump welde, pump overhauled, request spare parts

Preventive Action

Maintenance routine must be carried out as per PMS.

Applicable Tags

Root Causes- Job Factor

Excessive Wear and Tear

Root Causes- Management Factors

Inadequate Monitoring / Supervision

Direct Causes- Unsafe Conditions

Incident Reports Details Printed On: 25-Jul-2023 1/7

Fire and Explosion Hazards

Direct Causes- Unsafe Acts

Failure to Follow Repair / Maintenance Instructions

Substandard Acts

Failure to Comply with Manufacturer's Operating Instructions

Substandard Conditions

Fire and Explosion Hazard

On By Follow Up 18/May/2023 Nawin Khaware ETC has been changed from "03 May 2023" to "20 May 2023". 18/May/2023 Nawin Khaware his was a normal wear and tier, equipment has been repaired and ship staff have been advised to follow the PMS routines diligently. This incident could be considered as closed now.

Before & After Pictures

Before

After













