



## Maritec Tanker Management

### Defect List Details

Ship File No : N/A  
 Office File No : N/A  
 Form No : N/A  
 Issue : N/A  
 Revision : N/A  
 Rev Date : N/A

Vessel : Bahama Blue	Defect ID : 11	NCR # :	Is NCR ? : No
----------------------	----------------	---------	---------------

#### Defect Details

At around 0645hr aux. f.w cooling pimp no. 2 stopped and indicating overload alarm at the panel.Isolate source and checked for insulation/omhs value,found normal value.Removed top cover of the motor fan and tried to rotate ,but is not moving.Dismantled the pump including mototr for inspection and found motor bearing was seaized.We don't have sparemotor bearing onboard.Assembled and isolated the pump .Awaiting for new spare mtor bearing to arrived,personnel involved with dismantled and assembly.Chief engineer,2nd engineer,electrical officer from 0700hrs to 0900hrs.

Requisition Code :

#### Categories

Primary :	E/R Machinery	Inspector - Internal :	Francis Timothy Monteiro	Vessel Dept :	Deck
Secondary :	Auxiliary Equipment	Inspector External :		Office Dept :	Technical
		Inspection Date :			

#### Applicable Dates

Date Raised : 24-Jul-2019	ETC : 24-Jul-2019	Date Completed : 24-Jul-2019
---------------------------	-------------------	------------------------------

#### Other Details

Priority : Normal	Assigned By : Vessel	Verified By : Francis Timothy Monteiro
Display in Daily Meeting? : No	SFI :	Verified On : 31/Jul/2019

#### Causes

#### Corrective Action

#### Preventive Action

#### Applicable Tags

#### Follow Up

On	By	Follow Up	
31/Jul/2019	Francis Timothy Monteiro	New Motors for the Aux. cooling pump supplied by the makers and installed in place and issue of heating of the motors was resolved.	

31/Jul/2019	Francis Timothy Monteiro	New Motors for the Aux. cooling pump supplied by the makers and installed in place and issue of heating of the motors was resolved.	<a href="#">Link1</a> <a href="#">Link2</a> <a href="#">Link3</a> <a href="#">Link4</a> <a href="#">Link5</a> <a href="#">Link6</a> <a href="#">Link7</a> <a href="#">Link8</a> <a href="#">Link9</a> <a href="#">Link10</a> <a href="#">Link11</a>
31/Jul/2019	Francis Timothy Monteiro	New Motors for the Aux. cooling pump supplied by the makers and installed in place and issue of heating of the motors was resolved.	
31/Jul/2019	Francis Timothy Monteiro	New Motors for the Aux. cooling pump supplied by the makers and installed in place and issue of heating of the motors was resolved.	
31/Jul/2019	Francis Timothy Monteiro	New Motors for the Aux. cooling pump supplied by the makers and installed in place and issue of heating of the motors was resolved.	
31/Jul/2019	Francis Timothy Monteiro	New Motors for the Aux. cooling pump supplied by the makers and installed in place and issue of heating of the motors was resolved.	

Before & After Pictures	
Before	After